Ships detained in Hong Kong by PSC Section in May 2006

No	IMO Number	Ship Name	Flag	YOB	GRT	Ship Type	Class	Ship Company	Date of Detention	Date of Release	Nature of Deficiencies (responsible RO, if any)
1	9295945	CHAITEN	Liberia	2005	66280	container ship	Lloyd's Register	Peter Dohle Schiffahrts- KG	02/05/06	02/05/06	FIRE SAFETY MEASURES: emergency fire pump/emergency fire pump not working
2	9338981	TIAN ZHU	Tuvalu	2003	2358	general cargo/multi- purpose ship	International Ship Classification Pte. Ltd.	Tianjin Centrans Shipping Management Co. Ltd	09/05/06	11/05/06	SAFETY OF NAVIGATION: nautical publications/sailing direction NP30 not available onboard for voyage planning, distress messages: obligations and procedures, FIRE SAFETY MEASURES: doors within main vertical zone/one engine room self closing door not able to close properly, ventilation/engine room ventilator at starboard not able to close properly, LIFESAVING APPLIANCES: stowage of liferafts/one liferaft at starboard with improper securing lashing
3	7713424	NOBLE FAMILY	Cambodia	1978	4082	general cargo/multi- purpose ship	International Degister	Representative Office of Pamela Corporation in Vladivostok	13/05/06	18/05/06	WORKING SPACES (ILO 147): safe means of access, obstruction/slipping, etc., FIRE SAFETY MEASURES: readily availability of fire fighting equipment, PROPULSION AND AUXILIARY MACHINERY: cleanliness of engine room, LIFESAVING APPLIANCES: launching arrangements for survival craft/the limit switch of lifeboat launching arrangements not working (starboard seized, port missing)
4	9196474	ASIAN GENIUS	Panama	1998	4346	general cargo/multi- purpose ship	Nippon Kaiji Kyokai	Santoku Senpaku Co Ltd	15/05/06	16/05/06	SAFETY OF NAVIGATION: charts/charts for Hong Kong waters not updated (e.g. BA4119, 4121), distress message: obligations and procedures/no entry in the log book for distress and urgency message received, nautical publications/publication sailing direction NP30 not available onboard, LIFESAVING APPLIANCES: operational readiness of lifesaving appliances/primary and reserved gasoline tanks less than half was filled (insufficient fuel), rescue boats/rescue boat starboard inflatable tube leaking and found holed
5	8208232	EVER GUARD	Panama	1982	37042	container ship	Nippon Kaiji Kyokai	Evergreen Marine Corp (Taiwan) Ltd (Evergreen Line)	16/05/06	16/05/06	SAFETY OF NAVIGATION: nautical publications/notice to mariner not updated, charts/charts e.g. 4121, 937, 4119 not updated, charts/chart BA4128 not updated, LIFESAVING APPLIANCES: lifeboats/stbd. lifeboat not ready for use, e.g. rudder not yet installed, search light not connected to power source and FE not in position etc., PROPULSION AND AUXILIARY MACHINERY: cleanliness of engine room/savealls of generator fuel oil filter with excess fuel oil
6	7238412	NAM SAN 6	Korea, Democratic People's Republic	1972	481	general cargo/multi- purpose ship	Society (former Joseph	Korea Namsan Shipping Corporation	22/05/06	24/05/06	LIFESAVING APPLIANCES: lifejackets, SAFETY OF NAVIGATION: charts nautical publications/sailing direction for intended voyage not available
7	9004700	SPLENDOR	Panama	1990	5552	general cargo/multi- purpose ship	1	Harmony Transportation Co., Ltd	24/05/06	24/05/06	STABILITY, STRUCTURE AND RELATED EQUIPMENT: emergency lighting, batteries and switches/emergency generator cannot start, PROPULSION AND AUXILIARY MACHINERY: cleanliness of engine room/engine room bilge tank top found very oily, cleanliness of engine room/generators found very oily

8	7433268	RANAM	Korea, Democratic People's Republic	1981	9053	general cargo/multi- purpose ship	Society (former Joson	Korea Samildo Shipping Corp.	26/05/06	12/06/06	SAFETY OF NAVIGATION: nautical publications/sailing direction NP30, NP32 & chart catalog not updated, distress messages: obligations and procedures/distress message received on 13/3/2006 without master response action entry record, SHIP'S CERTIFICATES AND DOCUMENTS: safety management certificate (SMC/ISM Code)/intermediate verification expired was due/expired on 31.03.2006, FIRE SAFETY MEASURES: doors within main vertical zone/E/R fire door from accommodation could not close by self-closing device, fire fighting equipment and appliances/fire mains forward holed/leaking and part for paint locker broken
9	7725075	MING TAY NO. 1	Mongolia	1977	477	other types	•	Sea Wide Shipping Co., Ltd.	26/05/06	06/06/06	CERTIFICATION AND WATCHKEEPING FOR SEAFARERS: certificates for Master and officer, SAFETY OF NAVIGATION: lights, shapes, sound-signals, SOLAS RELATED OPERATIONAL DEFICIENCIES: communication PROPULSION AND AUXILIARY MACHINERY: cleanliness of engine room

Note: The classification societies listed are not necessarily the entities carrying out the surveys relevant to the deficiencies that warranted detention and/or for issuing the certificates.