

Ships detained in Hong Kong by PSC Section in October 2010

No	IMO Number	Ship Name	Flag	YOB	GRT	Ship Type	Class	Related ROs	Ship Company	Date of Detention	Date of Release	Nature of Deficiencies (responsible RO, if any)
1	9345960	APL DENVER	Antigua and Barbuda	2007	43071	Container ship	Germanischer Lloyd	Germanischer Lloyd	Hanseatic Lloyd Schiffahrt Gmbh & Co. Kg	05/10/10	05/10/10	FIRE SAFETY MEASURES: readily availability of fire fighting equipment, pneumatic sys. for remote closing the e/r ventilation/fire flaps & f.o./l.o. quick closing valves: (i) abt. 7 litres of condensation water drained from reserved air cylinder; (ii) min. working pressure of the system and present setting of the pressure control device not sure with supporting evidence (Germanischer Lloyd)
2	9603867	TONG CHENG 602	Panama	2010	2981	General cargo/multi-purpose ship	Panama Maritime Documentation Services	Overseas Marine Certification Services; Panama Maritime Documentation Services	Bao Xin Marine United	11/10/10	12/10/10	SAFETY OF NAVIGATION: Automatic Identification System (AIS), AIS with no vessel information shown; LOAD LINES: railing, cat walks, port main deck handrail broken and damaged (obstruction for passing ford & aft main deck), manholes/flush scuttles, chain locker manhole cover not tightened; FIRE SAFETY MEASURES: doors within main vertical zone, e/r escape door not self-closing; SOLAS RELATED OPERATIONAL DEFICIENCIES : muster list, muster list not in working language for crew members; ISM RELATED DEFICIENCIES: emergency preparedness, ISM emergency preparedness for item 1, 2, 3, 4 and 7 to rectify
3	8320846	SUNHILL	Panama	1984	25710	Oil tanker	American Bureau of Shipping	American Bureau of Shipping; China Classification Society	Callany Ltd	11/10/10	12/10/10	SOLAS RELATED OPERATIONAL DEFICIENCIES: other, pump room, many buckets with oil inside hung on the vent head of cargo pump strainers, and the stripping pump shaft leaking oil, bottom is oily on some part; ISM RELATED DEFICIENCIES: maintenance of the ship and equipment, ISM, as above deficiencies 4, 5, 7, 8, 9, 10, 11, 12, 13, 14, 16 with code 17, the ship's maintenance was poor, the ism is not running effectively
4	9014080	LAUTAN MAS	Indonesia	1991	17156	Container ship	Nippon Kaiji Kyokai	Nippon Kaiji Kyokai	PT Pelayaran Tirtamas Express	28/10/10	01/11/10	SAFETY OF NAVIGATION: charts, all Hong Kong area ba charts not corrected since 2008, no notice to mariner supplied on board, charts, ba chart 4127 and 4119 are old edition; LIFESAVING APPLIANCES: lifeboats, port side lifeboat engine can not start, lifeboats, starboard lifeboat rudder seized, could not move; FIRE SAFETY MEASURES: fire prevention, engine room bottom, purifier room, much oil accumulated

Note: The classification societies listed are not necessarily the entities carrying out the surveys relevant to the deficiencies that warranted detention and/or for issuing the certificates.