

Ships detained in Hong Kong by PSC Section in November 2012

No	IMO Number	Ship Name	Flag	YOB	GRT	Ship Type	Class	Related ROs	Ship Company	Date of Detention	Date of Release	Nature of Deficiencies (responsible RO, if any)
1	8656879	HONG D	Mongolia	1989	2005	General cargo/ multipurpose	Sing-Lloyd	Sing-Lloyd	JIAYU HK DEVELOPMENT CO. LTD	02/11/12	12/11/12	SAFETY OF NAVIGATION: radar/one radar out of work, gyro compass/gyro-compass out of work; FIRE SAFETY: ready availability of fire fighting equipment/emergency fire pump not ready for use, fire-dampers/e/r fire dampers cannot be closed, fire doors/openings in fire-resisting divisions/accommodation area fire door auto-close devices out of work, fire detection and alarm system/accommodation area fire call point out of work; WATER/WEATHERTIGHT CONDITIONS: doors/forepeak store water tight door heavy corroded; ISM: resources and personnel/no crew member familiar with the operation of GMDSS equipment, OWS and sewage treatment plant; POLLUTION PREVENTION - MARPOL ANNEX I: oil and oily mixtures from machinery spaces/e/r tank top about 40cm oily water accumulated
2	9640451	LOGINDO STATURE	Indonesia	2011	1461	Offshore supply	Americian Bureau of Shipping	Americian Bureau of Shipping	PT Logindo Samudramakmur	08/11/12	12/11/12	CERTIFICATE AND DOCUMENTATION - SHIP CERTIFICATES: other (certificates)/ship radio station licence n/a, other (certificates)/civil liability for bunker oil pollution damage cert. n/a, continuous synopsis record/CSR n/a, international anti-fouling-system certificate/compliance of anti-fouling document n/a, to be verified, CERTIFICATE AND DOCUMENTATION - documents/garbage record book/garbage record book n/a; EMERGENCY SYSTEMS: muster list/muster list not prepared and no drills since delivery; POLLUTION PREVENTION - MARPOL ANNEX V: garbage management plan/garbage management plan n/a, RADIO COMMUNICATIONS: satellite EPIRB 406MHz/1.6GHz/EPIRB not installed; SAFETY OF NAVIGATION: lights, shapes, sound-signals/ship's length is 54m, second masthead light not provided; FIRE SAFETY: fixed fire extinguishing installation/CO ₂ system for e/r, releasing cabinet door opening failed to activate audible alarm in e/r; POLLUTION PREVENTION - MARPOL ANNEX I: oil filtering equipment/OWS not operable when required for testing; POLLUTION PREVENTION - MARPOL ANNEX IV: sewage treatment plant/sewage treating plant failed to start
3	8221947	SHEN XING	Panama	1982	2047	Refrigerated cargo	Panama Maritime Documentation Services	Panama Maritime Documentation Services	Fu Sheng Shipping Safety Management Consultant Co Ltd	12/11/12	15/11/12	WATER/WEATHERTIGHT CONDITIONS: doors/maindeck portside, watertight door can not be closed tightly; FIRE SAFETY: operation of fire protection systems/key officer not familiar with operation of fixed fire fighting system, fire doors/openings in fire-resisting divisions/e/r entrance firedoor self close device broken; RADIO COMMUNICATIONS: operation of GMDSS equipment/key officer unable to operate GMDSS equipment; POLLUTION PREVENTION - MARPOL ANNEX I: oil and oily mixtures from machinery spaces/25cm oily water accumulated in e/r tank top; EMERGENCY SYSTEMS: fire drills/crew not familiar with e/r fire drill duty and use of BA set, ventilator kept running during drill

4	8735924	O KA SAN	Korea, Demoratic People's Republic of	1995	1861	Container	Korea Classification Society	Korea Classification Society	Korea Ryonghung Shipping Co	13/11/12	15/11/12	SAFETY OF NAVIGATION: nautical publications/latest edition NP 30/32 and IMASAR III for intend voyage not available onboard; FIRE SAFETY: maintenance of fire protection systems/FSS maintenance plan & records not available onboard during inspection, fire fighting equipment and applicances/ fire hoses leaked seriously during testing, fire doors/openings in fire-resisting divisions/e/r entrance & stairway fire doors can not be closed tightly, evaluation of crew performance (fire drills)/officer & crew don't know how to carry out fire drill; POLLUTION PREVENTION - MARPOL ANNEX I: oily and oily mixtures from machiery spaces/25cm oil accumulated in e/r tank top
5	8810384	KUM SONG 8	Korea, Demoratic People's Republic of	1988	1485	General cargo/ multipurpose	Korea Classification Society	Korea Classification Society	Korea Jamaedo Shipping Co	26/11/12	04/12/12	STRUCTURAL CONDITIONS : ballast, fuel and other tanks - E/R suction/discharge valves for No.1 p'side FO tank circulating pump not fitted on tank as required by SOLARS II-2 R/15, ballast, fuel and other tanks - two sounding pipes for No.1 FO tanks (P&S) were located inside enclosed space without air ventilation; POLLUTION PREVENTION - MARPOL ANNEX I: Oil and oily mixtures from machinery spaces - excess oily water accumulated in E/R tank top; FIRE SAFETY: operation of Fire protection systems - crew members not familiar with the location of FFS (isolating valve); ISM: resources and personnel - crew members not familiar with the operation of MF/HF DSC, resources and personnel - crew members not familiar with the operation of emergency steering; WATER/WEATHERTIGHT CONDITIONS: ventilation, air pipes, casings - poop deck, steering gear room ventilation air pipes holed (P&S); PROPULSION AND AUXILIARY MACHINERY: auxiliary engine - no documented evidence showing that the circulating pumping system was approved by flag administration

Note: The classification societies listed are not necessarily the entities carrying out the surveys relevant to the deficiencies that warranted detention and/or for issuing the certificates.