

Ships detained in Hong Kong by PSC Section in June 2015

No	IMO Number	Ship Name	Flag	YOB	GRT	Ship Type	Class	Related ROs	Ship Company	Date of Detention	Date of Release	Nature of Deficiencies (responsible RO, if any)
1	8315152	SMART SAIL	Saint Vincent and the Grenadines	1985	13982	General cargo/multipurpose	Registro Italiano Navale	Registro Italiano Navale; Nippon Kaiji Kyokai	Tranglory Shipping Co Ltd	01/06/15	09/06/15	RADIO COMMUNICATIONS: MF/HF radio installation/MF/HF radio unable to test by emergency source of power and antenna broken; WATER/WEATHERTIGHT CONDITIONS: machinery space openings/E/R skylight, all securing bolts and butts missing; LIFE SAVING APPLIANCES: lifeboats/lifeboats, embarkation ladder rope rotten, tricing pendant damaged/wasted wire, plug not marked, tie band keel connection bolts and nuts seriously corroded, elec. torch for morse signalling not available, browsing tackles damaged, launching block (S.B. AFT) serious corroded, S74/C111/R41.1; ISM: other (ISM)/the SMS as implemented on board failed to ensure emergency preparedness and effective maintenance as evidenced by deficiencies above
2	8611752	SHENG HO	Taiwan, China	1986	2015	Special purpose ship	CR Classification Society	CR Classification Society	Ta-Ho Maritime Corp	03/06/15	08/06/15	EMERGENCY SYSTEMS: emergency fire pump and its pipes/emergency fire pump not working; FIRE SAFETY: fire-dampers/4 pcs fire dampers not working for galley and mess rooms
3	9465497	HUI FENG	Panama	2006	2956	General cargo/multipurpose	Overseas Marine Certification Services	Overseas Marine Certification Services; Panama Marine Survey and Certification Services Inc.	Xiamen Xinqihui International Ship Management Co Ltd	08/06/15	17/06/15	WATER/WEATHERTIGHT CONDITIONS: covers (hatchway-, portable-, tarpaulins, etc.)/fcl store hatch cover unable to close and covered by canvas, not weather-tight, covers (hatchway-, portable-, tarpaulins, etc.)/poop deck hatch cover for steering gear room unable to close weather tight
4	9697076	MONTY ORR TIDE	Vanuatu	2014	3927	Offshore supply	American Bureau of Shipping	American Bureau of Shipping	Pan Marine Do Brasil Ltda	12/06/15	20/06/15	LIFE SAVING APPLIANCES: rescue boats/rescue boat cannot start in 20 mins; EMERGENCY SYSTEMS: emergency fire pump and its pipes/emergency fire pump cannot start and no water pressure on deck; POLLUTION PREVENTION - MARPOL ANNEX IV: sewage treatment plant/sewage plant is not in use and air blower is off; ISM: shipboard operations/ships crew do not familiar with LSA (such as BA set testing) and FFA equipment (such as emergency fire pump). SMS is not followed and found failure
5	9151709	PL XING JI	Panama	1994	2998	General cargo/multipurpose	Overseas Marine Certification Services	Overseas Marine Certification Services	Ming Jin Shipmanagement Consultant Ltd	15/06/15	30/06/15	SAFETY OF NAVIGATION: charts/NTM no. 3-23 received on 14.6.2015, vessel departed last port on 13.6.2015 with NTM only up to no. 2 (8 Jan 2015), voyage charts not properly updated/corrected before commencement of voyage, echo sounder/echo sounder not properly displaying water depth, speed and distance indicator/speed log not properly working; FIRE SAFETY: fire detection and alarm system/bridge fire detecting system switched off, fault alarm displayed after switched on the system was switched off again by crew, fixed fire extinguishing installation/CO ₂ pipes for no. 2 cargo hold corroded/held; ISM: maintenance of the ship and equipment/as evidenced by above deficiencies, shipboard SMS cannot ensure safe operation & maintenance of ship

6	9181807	SEA STAR 9	Panama	1997	6178	General cargo/ multipurpose	Isthmus Bureau of Shipping, S.A.	Isthmus Bureau of Shipping, S.A.	Hong Kong Seastar Shipping Ltd	25/06/15	02/07/15	RADIO COMMUNICATIONS: MF/HF radio installation/MF/HF DSC ship-shore test record not available, failed to receive acknowledgement during inspection, antenna partly damaged, insulation damaged/missing; SAFETY OF NAVIGATION: lights, shapes, sound-signals/air horn defective; ISM: documentation-ISM/SMS document not available on board, including hour of rest records, training manual for shiptype specific, muster list, working language and crew communication, and document required r.o. endorsement; EMERGENCY SYSTEMS: emergency fire pump and its pipes/emergency fire pump failed to pressurise water on deck, pressure gauge reading zero
7	9227041	DERYOUNG SUNSHINE	Taiwan, China	1999	6354	General cargo/ multipurpose	CR Classification Society	CR Classification Society	Deryoung Maritime Co Ltd	30/06/15	03/07/15	RADIO COMMUNICATIONS: MF radio installation/MF DSC failed to test ship-shore, indicated EM error; LIFE SAVING APPLIANCES: lifeboats/lifeboats battery selectors (P and S), hand made by crew and failure and required sandpaper to clean contacts for over five minutes before power connected to start engine, port lifeboat engine leaking

Note: The classification societies listed are not necessarily the entities carrying out the surveys relevant to the deficiencies that warranted detention and/or for issuing the certificates.